

# Earth leakage in the DL1 and DL21 system.

---

## Issue

It has been noted that CD402CU-SC early serial numbers (before 150030) may show a earth leakage in the 24V.

## Problem

Due to a production error in these units a resistor R97 has been placed on the card that short circuits the power ground to the Earth/Housing. This is removed in later batches.

## Fix

Replace the unit, or remove the resistor R97 by removing the back off the Display unit and removing the Resistor on the bottom left. This can be unsoldered, or cut away.

