

Service data bulletin



Instrument: Transceiver unit DL850T27-SB
SDB no: SDB_DL850_11


Date: 05.01.2011
Created by: Geir Theodorsen

SUBJECT: On a batch of Back plane PCBs washers are mounted which should not have been mounted. This washer may lead to short circuit in the PCB.
The transceiver unit serial numbers in this batch are:
DT-10618 to DT-10622, DT-10625.
SK SK111000228, SK311000259 to SK371000264, SK371000266 to SK371000274 and SK421000278.



Washers are mounted on the back side of this Back Plane PCB.
3 PCBs, Eurocase and transformer have to be removed before PCB can be taken out.

The washers are mounted under the screws for the connectors, two for each connector, a total of 12 washers.

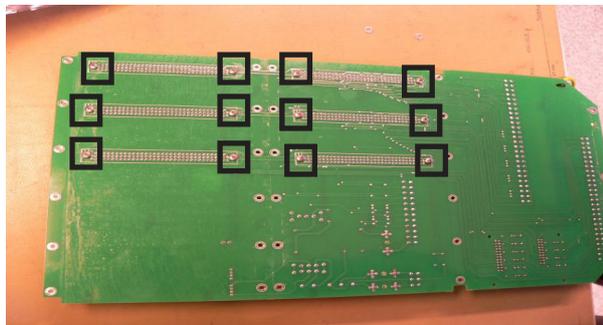

Not correct.
Washers should be removed



Correct.
No washer

