




## Service data bulletin

Instrument: GDS101/102  
DL850/EML224

Date: 11.04.2007  
Created by: Geir Theodorsen

- 
- SUBJECT:** SKIPPER Electronics has found some motherboards with bad contact. This is caused by dirt on contact surface or defective contact springs on motherboard ISA plug. Most motherboards in the marked have bifurcated contact springs. (See picture) Some units in the market have non bifurcated contact springs.
- SYMPTOMS:** All sorts of CPU related problems
- WHAT TO DO:** If CPU related problems occurs, please clean the contact surface of CPU plug with isopropanol. If this does not help then change any non bifurcated motherboards with a bifurcated. Motherboard part number: ZZZ-010006

Bifurcated contact spring  
(Bifurcated=Contact surface is  
divided into two parts)

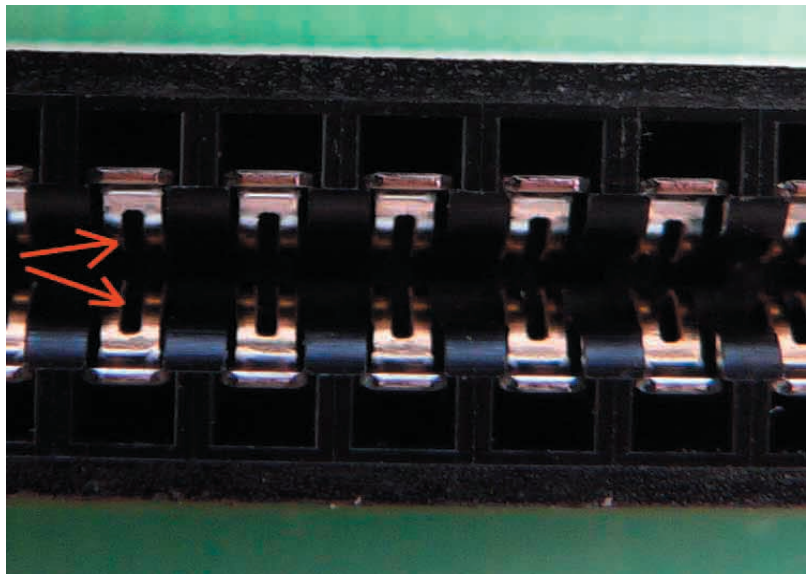

Non bifurcated contact spring

