



Service data bulletin


Instrument: GDS101

Date: 23.03.2006


Created by: Geir Theodorsen

SUBJECT: Plugs on transceiver board have no guides.
This makes it possible to insert cables into board in wrong direction.

WHAT TO DO: When replacing transceiver board or cables to transceiver board you have to be careful
insert the cables the correct direction.

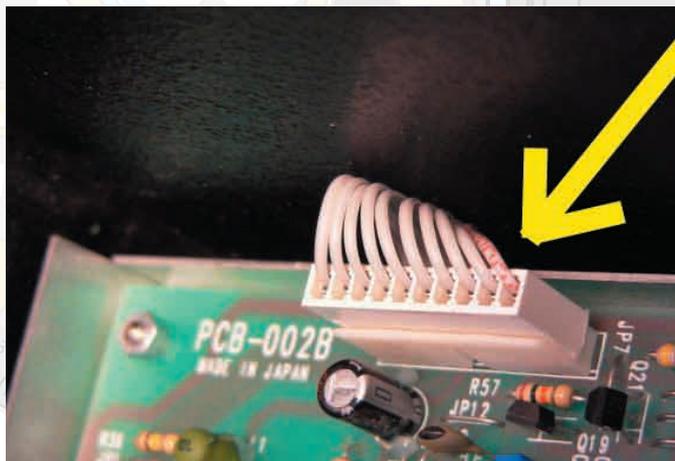

CN1: Red lead right

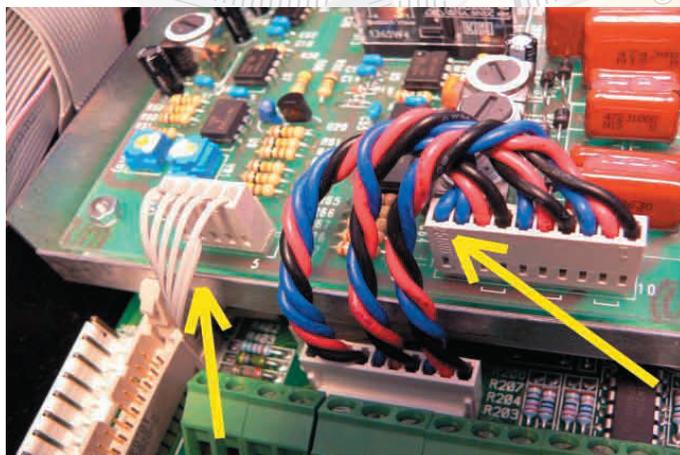

CN2: 2 blue leads left

CN3: Cutted lead right