




## Service data bulletin

Instrument: GDS101

Date: 23.03.2006

Created by: Geir Theodorsen

- SUBJECT:** Bad contact i buscable plug on motherboard.  
If motherboard or buscable has been inserted there is ocational bad contact closure in plug.
- SYMPTOMS:** Not possible to enter Flash memory (After service)

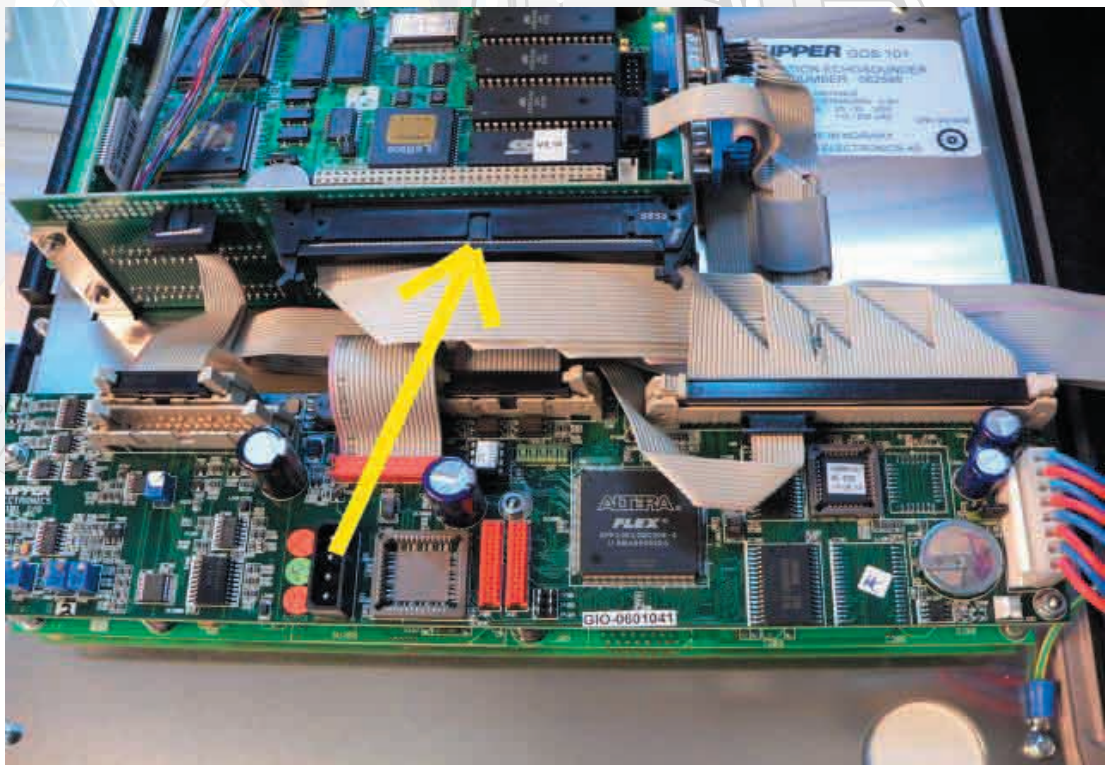

- WHAT TO DO:** When inserting the buscable into the motherboard, **ALLWAYS** insert and take out 2 or 3 times to ensure best possible contact in plug.