

Technical bulletin


SB-100-SB Sea valves

Products: SB-100-SB, SB-100-SA, DB-100-SB and DB-100-SA
100mm Sea valves

Issue: A number of Sea valves have been reported the two threaded holes in the intermediate element for installing 2 x thread bolts are not straight.
This can result in difficulties in entering the Clamping unit onto the bolts.

How to proceed the installation:

Do not use high force Bending the bolts to install the Clamping unit.
The threaded bolts can be mounted onto any of the 6 unthreaded holes.
Remember 4 x Nuts M16 and 2 x Spring washer M16 on each bolt.

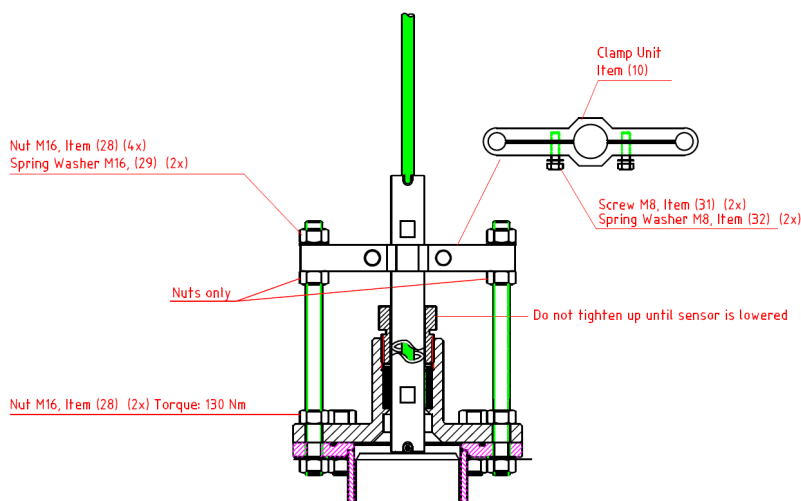


January/February 2024:

A number of sea valves are produced without threads in the “two threaded holes”.

This to enable easy installation and movement of the clamping unit.

The threaded bolts can then be mounted onto any of the unthreaded holes.

Remember 4 x Nuts M16 and 2 x Spring washer M16 on each bolt.

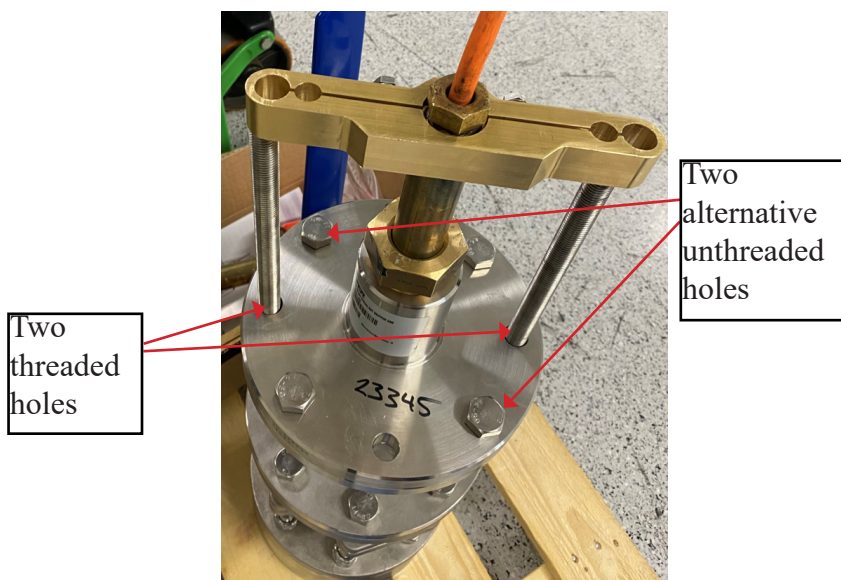

Jotron Skipper AS
Enebakkveien 150
P. O. Box 151, Manglerud
0612 Oslo
Norway

E-mail: support.skipper@jotron.com
Telephone: +47 23 30 22 70
www.skipper.no

Date: 2024-02-14

 **JOTRON**
SKIPPER