




Service data bulletin

Instrument: DL850

Date: 10.11.2006
Created by: Geir Theodorsen

SUBJECT: Installation of serial ISA Card



PARTS REQUIRED:

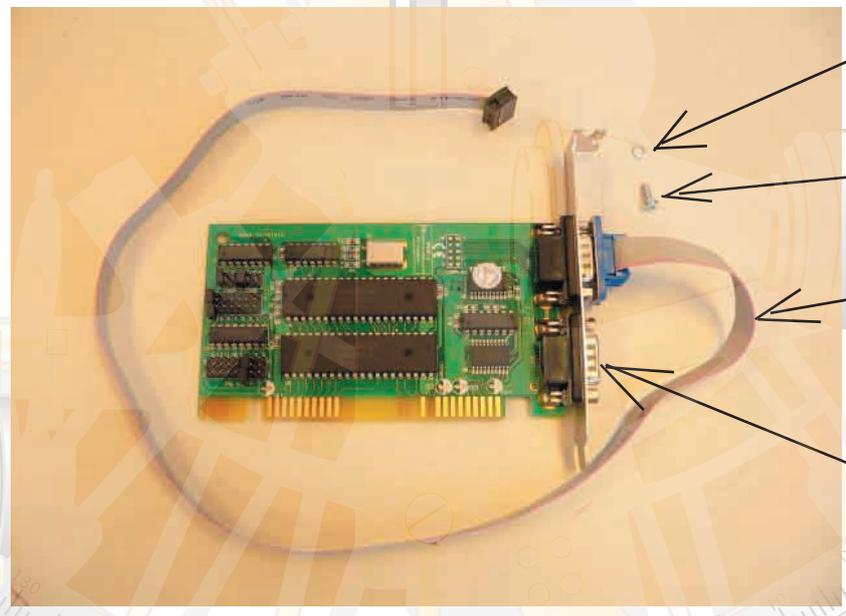

- 3mm spring washer
- 3x8mm screw
- Cable NMEA
Part number: ZZK-01030
- Serial ISA card
Part number: ZZZ-030026



SETTINGS:

COMA: TRANSFER RATE 115.2K IRQ5 COM7
COMB: TRANSFER RATE 115.2K IRQX COMX - X = open

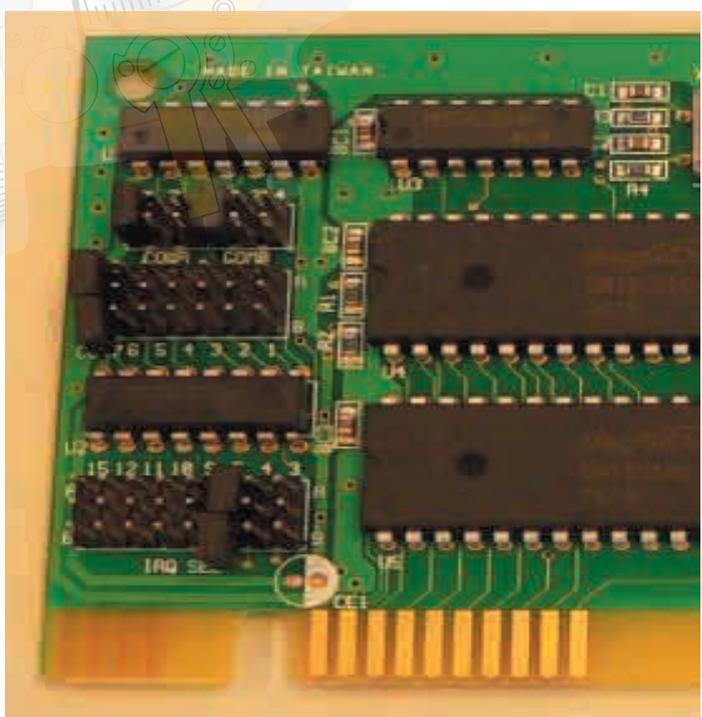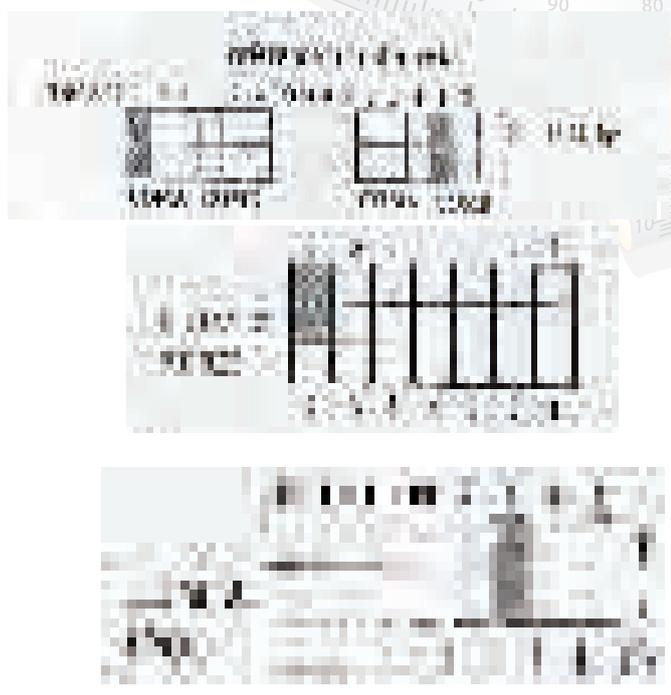

Insert the Serial ISA card into the free ISA port on mother board.
Note the cable routing.

Fasten with screw and spring washer.

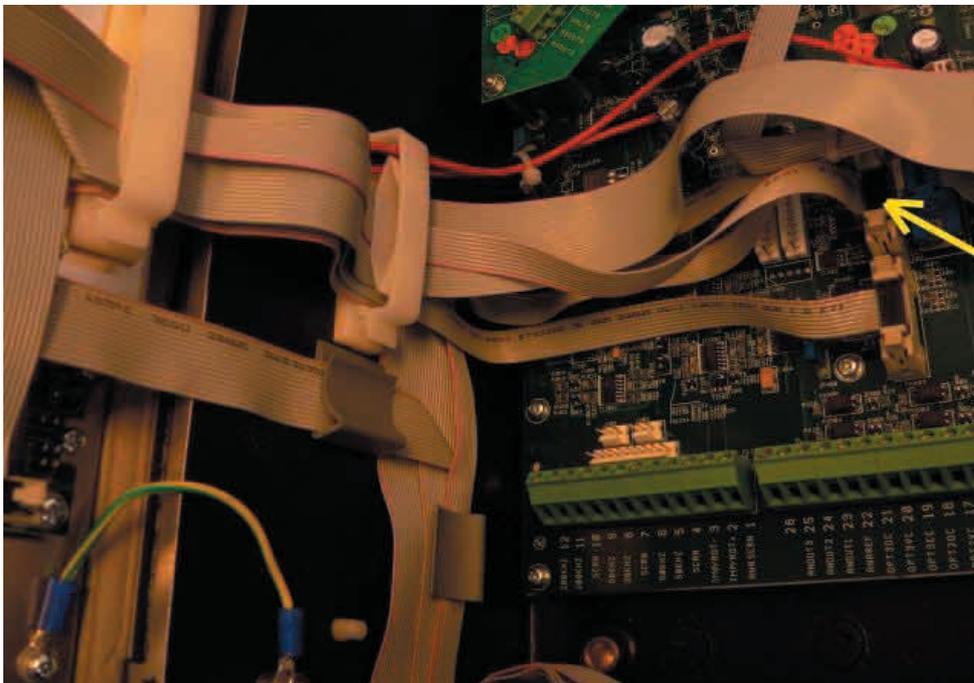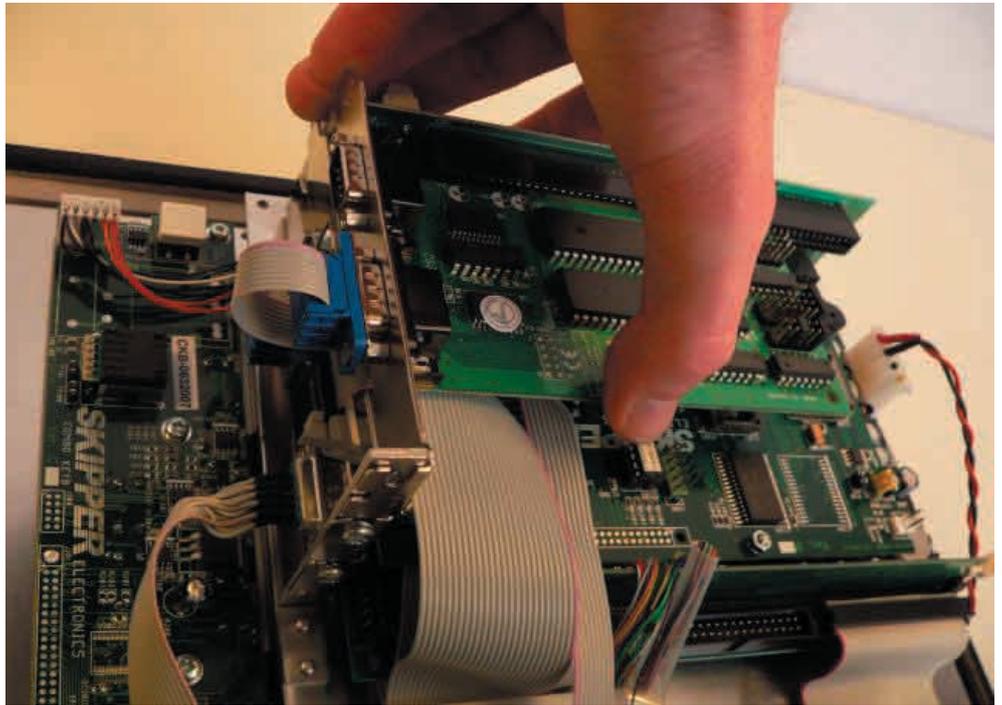

Insert the plug into free NMEA1 J400

Set the jumper JP400 in upper position.
(Pos 1-2)

